Metal seats prevent steam leaks

During construction of a natural gas combined cycle power plant, a leading OEM was experiencing difficulties brought on by seventy leaking globe valves in severe service applications. Metal-seated ball valves proved to be the solution.

Selected by David Sear

Requirements

In North America, a leading OEM was undertaking construction of a power plant when leaks were identified in seventy globe valves. These were located in high-pressure, high-temperature severe service applications. Specifically, the OEM was faced with the following concerns:


- Safety The OEM made initial attempts to fix the gland packing leaks of the originally installed globe valves by replacing the packing and retorquing the gland packing bolts. Despite their determined efforts, this caused not only a concern of visibility, but as the environmental ambient temperature conditions dropped, the leaking steam would freeze, elevating the level of concern. While the OEM had several requirements, safety was their top priority. Before, the plant could be handed over to the end-user, the OEM knew they had to resolve these serious issues.
- Efficiency In addition to the globes' visible leakage, the hidden leakage leaking past the downstream seat became a major issue. Globe valves are permitted to leak, even when brand new going into the systems as they are only tested to Class IV, V or VI. In order for OEMs/ EPCs to keep to their contractual efficiency promises, it is imperative that steam is kept in the systems. The effects of steam loss results in significant efficiency losses.

At a glance:

Industry:	Power
Plant type:	1100+ MW natural
	gas combined cycle
	power plant
Application:	HRSG HP evaporator
	system and drains/
	vents
Location:	North America
Challenge:	Leaking globe valves
	in HP/HT service
Solution:	V1-1, zero-leakage
	metal-seated ball
	valves



Inside view of ValvTechnologies' manufacturing facility. The company is proud to report that all products are USA made and that it has complete control over all aspects of the manufacturing process.

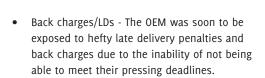

Solution

The OEM was sceptical about cutting out the globe valves and replacing them in-kind. By doing so, they would continue to face the previously identified challenges. The warranty team decided, instead, to replace them with ValvTechnologies' zero-leakage metal-seated ball valves. Once the decision was made, timing became critical and ValvTechnologies quickly implemented a resolution plan. The plan involved scouring their warehouses and distribution network to locate the valves necessary to not only resolve the leakage issues, but to get the valves expedited to site to meet the OEM's deadline.

The team's collaboration allowed ValvTechnologies to deliver 70 ball valves in a variety of sizes, pressure classes, materials, etc. required (1'' - 3'', 900# - 4500# in carbon steel, F22 and F91). All valves arrived in time and were installed within the remaining five weeks prior to the 0EM's liquidated damages (LDs) kicking in.

Result

In addition to helping the OEM overcome their immediate problem, ValvTechnologies assisted in addressing their safety concerns that also eliminated massive LDs and performance back charge penalties. The OEM's Optimization Team performed tests to determine the final outcome relating to performance and efficiency of this site. To the delight of the OEM and its customer, the reported outcome stated that after the steam leakages were fixed and valves were adjusted to capture more steam along with a variety of other maintenance procedures performed, the corrected steam turbine gross power was increased approximately by 10.3 MW. These actions not only increased the overall plant output by roughly 10 MW but also decreased the plant heat rate by 64 Btu/kWh.